


# Environmental Art LTD. Damage report

Site: Kirkbymoorside basketball area.

**Following site visit on 23/09/2021 we can conclude that:**

The damage sustained to the site did NOT occur due to normal use/wear and tear. And therefore repair is not covered under standard warrantee.

Arrows highlight where significant directed and repeated force has been applied; broken welds in the mesh and deformed grids. The mesh has been kicked in next to the post at the base of the mesh, wrenching it from the standard, riveted clamps inside the post assembly. The force has also broken the link clamps between the upper and lower sheets of mesh.

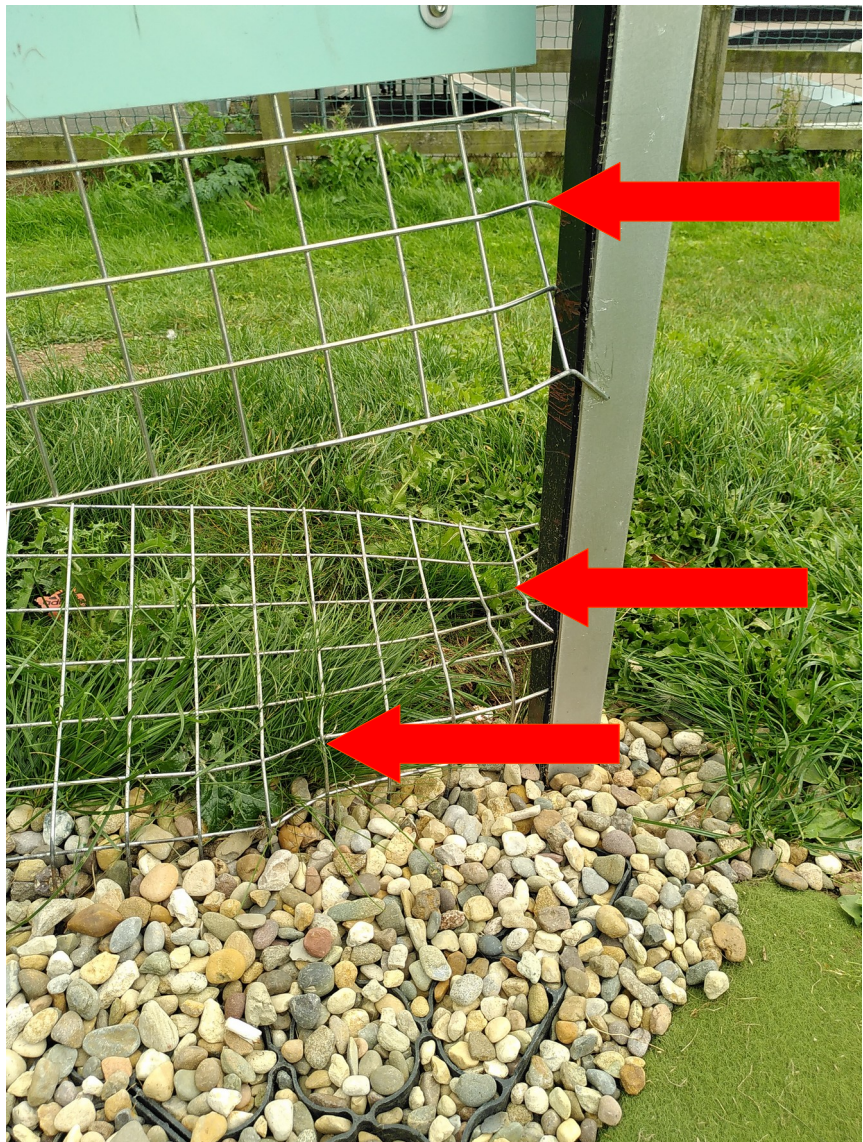



Bottom mesh section has been kicked repeatedly breaking the galvanised mesh clips on 2 side, severing the panel from the fence.



Arrows indicate broken weld on mesh and scratch marks indicative of the loose panel being pulled in and out against the post, this is not possible without manual interaction.



Detail of a torn galvanised mesh clip, these clips are rated to 150 N/m force well above the standard force expected by a ball, in all 24 clips have been broken or removed from this section.

